

## Practice Advisory 13: Egress stairs — earthquake checks needed for some

---

This Practice Advisory was issued in response to concerns about stair collapses in Christchurch CBD in the 22 February 2011 Aftershock and provides guidance on the assessment of stairs in existing multi-storey buildings.

This information was confirmed as current in December 2016.

Published on 30 September 2011

1st edition

**Of interest to** Building consent authorities, Builders, Designers

This Practice Advisory is issued as guidance information in accordance with section 175 of the Building Act 2004 and, if used, does not relieve any person of the obligation to consider any matter to which the information relates according to the circumstances of the particular case. This document is not a compliance document in terms of the Act and not a substitute for professional advice.

## Background

---

The Lyttelton earthquake (aftershock) of 22 February 2011 caused a number of stair failures in buildings in the Christchurch CBD. Although it is recognised that this earthquake made extraordinary demands on existing designs, the failure of stairs is of serious concern. MBIE considers it imperative that the circumstances of these failures are fully understood and the implications for similar buildings around New Zealand examined and acted upon.

The report commissioned by MBIE on the collapse stairs in the Forsyth Barr Building [1] illustrates an example of the issues and concerns. A report prepared for the Royal Commission [2] provides further comment on the issues and some considerations that may assist structural engineers to decide on retrofit actions. Design considerations for stairs are offered in the SESOC draft Practice Note [3].

### Practice Advisories

Practice Advisories are a response to concerns raised about the need to improve certain areas of structural design and construction and to alert the industry of the need to maintain high standards, and to identify particular issues of concern. We seek the support and cooperation of key people within the industry to circulate these Practice Advisories to their design engineers, draughtspeople, site construction staff, supervisory and management staff, building inspectors and others who should be alerted to these areas of concern.

MBIE will issue further Practice Advisories from time to time in response to emerging concerns on any aspect affecting the compliance of buildings with the Building Code.

## Purpose and scope of advisory

---

This Practice Advisory is to:

- alert practising structural engineers assessing existing multi-storey buildings throughout New Zealand to issues relating to safety of stairs.

It applies to all existing multi-storey buildings throughout New Zealand:

- to which members of the public have access, including office buildings, particularly those with scissor stair configuration, and

- have stairs designed to slide under seismic action, particularly those with the gap-and-ledge stair detail.

## Key concerns

---

- If the relative lateral displacements between adjacent floors of a building (the “inter-storey drifts”) are sufficiently large, a stair may be pulled off the ledge that supports the sliding end of the stair.
- The seating dimensions allowed in existing designs may not be sufficient to account for movements now expected.
- The maximum inter-storey drift in estimates of building displacement may not adequately account for variability and uncertainty.
- Details that have limited scope to allow closing movement may cause damage to the stair flights. This damage may shorten the flights and make them more likely to fall off their supports.
- Seismic gap details that have been partially or fully filled or are susceptible to being filled because of construction or maintenance errors may restrict or prevent closing movement
- Heavy finishes, fixtures and fittings in stairwells may come loose during an earthquake and fall and block the stairway or injure people using it.

## Main points and actions

---

### 1. Stairs designed to slide: Check if sliding is the designed intention or not

- This Practice Advisory applies to stairs that are detailed to slide on the end supports in order to accommodate the relative horizontal earthquake displacements between floors (known as “inter-storey drifts”).
- Stairs that are “built in” to the supports/landings at both ends are not covered by this Practice Advisory.

### 2. Overall allowance for movement – needs to be checked

- There are a number of loading Standards and material Standards that have prescribed the calculation of inter-storey drifts for NZ buildings (as far back as 1956). Typically, these design displacements are not consistent across the Standards. Therefore it is imperative that relative displacement between floors is calculated to the current Loadings Standard, NZS 1170.5.
- Clearances and seatings for stairs should be capable of sustaining at least twice the Ultimate Limit State (ULS) inter-storey displacements (drift) as calculated in accordance with NZS 1170.5.

### 3. Stair movement that closes the gap between the end of the stair and the support: Check support detail

- Calculate the inter-storey drifts as per Item 2 above.
- Check if the movement causes the sliding end of the stair to impact against the support (wall, beam or landing) - see Figure 1.
- If the lateral movement of the stair closes the gap, causing impact on the support/landing:
  - Look to increase the gap.
  - Check implications of bracing action as the stair struts between floors, if gap should close:
    - on the stair flight
    - on the supports at each end of the stair
    - on the building, as the stairs can significantly stiffen the building through the bracing action between floors, via unintended load paths. This results in the building attracting seismic forces that may be much larger than originally considered in the design of the building.
  - Check gap left for closing movement of the stairs:
- Check for objects in gap, such as debris or floor levelling compounds that may have occurred during earlier repairs/new fit-outs. Remove these obstructions.
- Modify detail to prevent further objects in the gap impeding movement. For example, cover plates over the gaps.

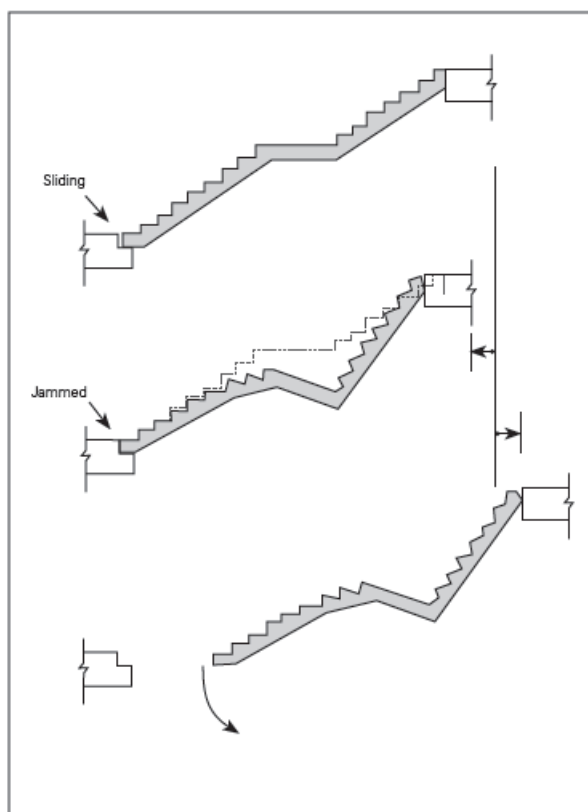


Figure 1: Inter-storey drift along the stair compresses the stair shortening it.

When earthquake reverses, the stair can now fall off the supporting ledge. [2].

#### 4. Progressive collapse – one stair falling on to the stairs below and collapsing them all: Mitigate:

- Using the inter-storey drifts from Item 2 above, construction tolerances, residual width of seating, spalling of the concrete ends of the stairs or the edges of the supporting ledge and other factors, determine what should be the width of the seating (contact area) between the sliding end of the stair and the support. If the available width of support is inadequate, install catch-frames or similar safety devices or engineer extensions of the ledge to ensure adequate width of support for the end of the stair.
- Stairs can swing sideways relative to its length. This can either damage the lining to the stairwells causing blockage of the egress path or, more significantly, can overload the connection at the other end of the stair, where the stair is fixed in to the support. This overload can result in failure of the bars or connection details there, resulting in collapse of that stair. The ability of the connections at the fixed ends must be checked and if there are issues, these need to be mitigated by design, i.e. by using NZS1170.5 Section 8, Requirements for Parts and Components.

#### 5. Wall finishes, fixtures and fittings within the stairwells: Make these safe

- Secure or remove any wall finishes that can not sustain the calculated inter-storey drift and could dislodge in earthquake shaking or building movement (particularly under inter-storey drifts).
- Restrain or remove any fixings and fixtures in the stairwells. Restrain in accordance with NZS 4219.

#### Actions to be taken

MBIE advises the following actions from the various parties:

- Structural engineers: When undertaking detailed assessments of buildings, strongly recommend to your client that checking of the stairs is included in your brief.
  - Recommend that any necessary retrofit measures be carried out as soon as possible. These should bring the stair earthquake safety performance to as nearly as is reasonably practicable to that of a stair in a new building of similar structural characteristics (see “when designing new buildings”).
- Territorial authorities: When advising owners of the need to renew their annual Building Warrant of Fitness Territorial Authorities are advised to bring this practice advisory to the attention of owners.
- Building Consent Authorities: When building consent applications are made for any work on a multi-storey building with sliding stair details, Building Consent Authorities are advised to bring this practice advisory to the attention of owners.
- Building owners with concerns: Owners should contact a chartered professional engineer with suitable qualifications and experience to review the stair design and make recommendations for retrofit work.

## When designing new buildings

### Do:

- Do use details which allow stair flights to slide on landings without restrictions
- Do take into account variability and uncertainty in estimates of building displacement to provide resilience. Clearances and seatings for stairs should be capable of sustaining at least twice the Ultimate Limit State (ULS) inter-storey displacements as calculated in accordance with NZS 1170.5, after allowances for construction tolerances.
- Do take account of disproportionate collapse, i.e. progressive collapse resulting from a stair flight failure

### Don't:

- Don't use details that restrict closing movement that may cause damage to the stair flights. This damage may shorten the flights and make them more likely to fall off their supports. The freedom of movement may be further restricted by debris or other material in the movement space.
- Don't use seismic gap details, particularly gap-and- ledge stair detail, which are susceptible to being filled by construction or maintenance error and thereby restricting closing movement.
- Don't allow stair wells to have heavy finishes, fixtures or fittings that could come loose during earthquake movement. They may fall and block the stairway or injure people evacuating the building.

## References

---

Beca Carter Hollings and Ferner Ltd (2011), Investigation into the Collapse of the Forsyth Barr Building Stairs on 22 February 2011. Report prepared for the Department of Building and Housing, September 2011

Bull, D (2011), Stair and Access Ramps between Floors in Multi-storey Buildings. Technical paper prepared for the Canterbury Earthquakes Royal Commission, August 2011

SESOC Practice Note: Design of conventional structural systems following the Canterbury Earthquakes, September 2011

---

All guidance related to D1 Access Routes (<https://www.building.govt.nz/building-code-compliance/d-access/d1-access-routes/>)



**MINISTRY OF BUSINESS,  
INNOVATION & EMPLOYMENT**  
HĪKINA WHAKATUTUKI

New Zealand Government

This information is published by the Ministry of Business, Innovation and Employment's Chief Executive. It is a general guide only and, if used, does not relieve any person of the obligation to consider any matter to which the information relates according to the circumstances of the particular case. Expert advice may be required in specific circumstances. Where this information relates to assisting people:

- with compliance with the Building Act, it is published under section 175 of the Building Act
- with a Weathertight Services claim, it is published under section 12 of the Weathertight Homes Resolution Services Act 2006.